



CONTROLS & DRIVES LTD

The Industrial Automation Specialists



Technical Tip


GOT2000
SCREEN PASSWORDS



Part of the **B P X** Group

Setting up screen passwords for GOT2000


- **Go to:** Common > GOT Environmental setting > Security
- **Click on:** Level
- **Set Security Level Device:** for example 'D100' Register
- **Set Security Level Password:** You can set multiple passwords for hierarchy of access

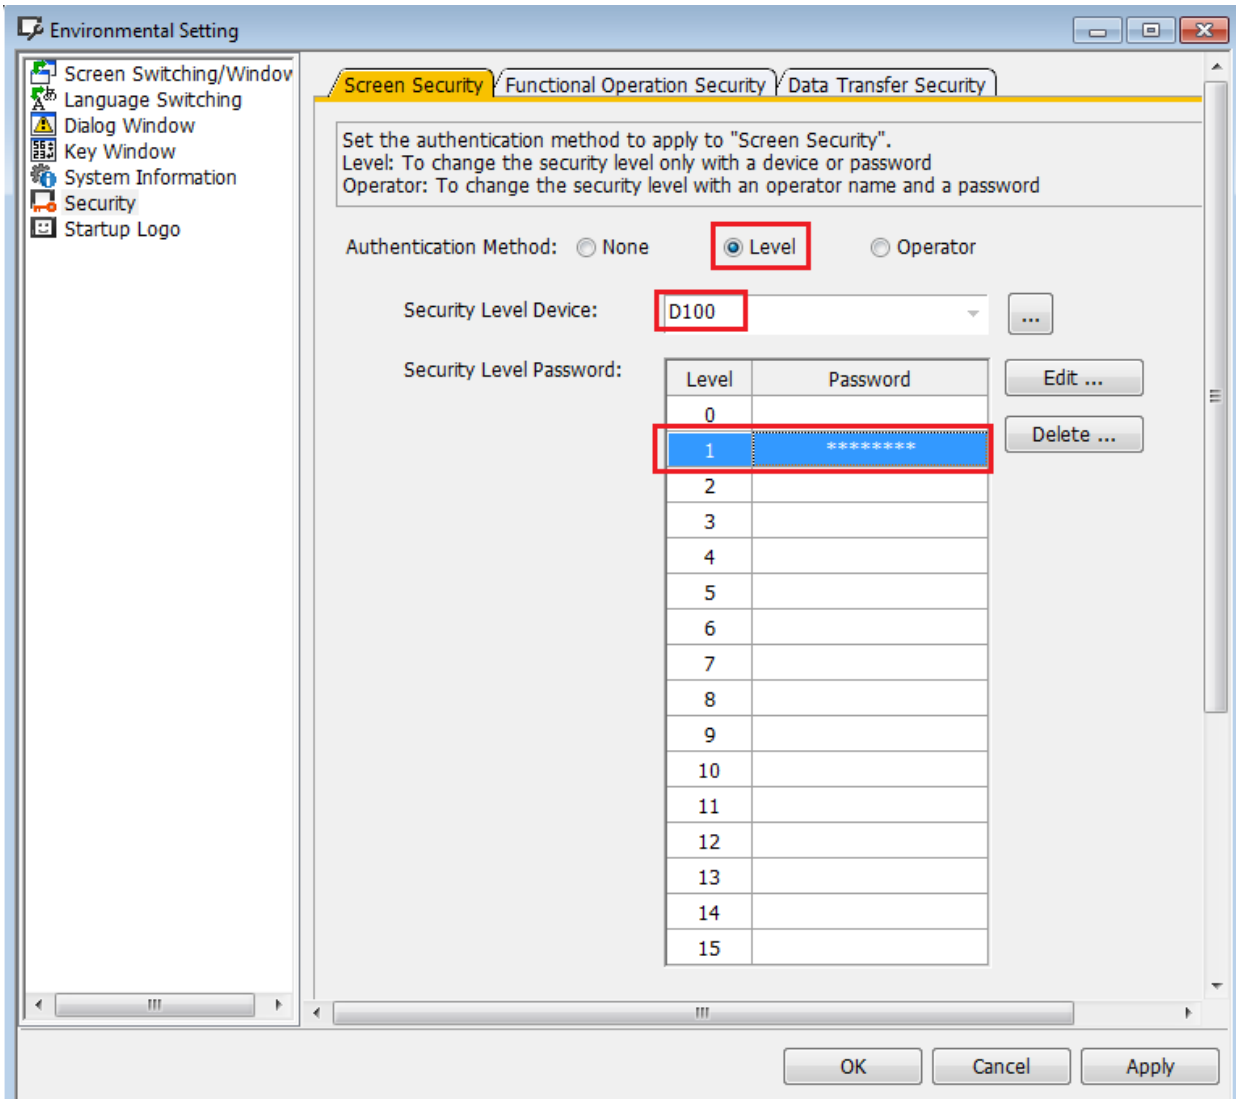

In this example the password is '1234'
Once these are filled click on 'APPLY and OK'

The next stage is to apply a security level to a specific screen(s) accordingly.


In this example base screen 2 is set to level security 1 therefore a keypad will be prompt as soon as you try to access screen 2. You can access these settings in screen property.

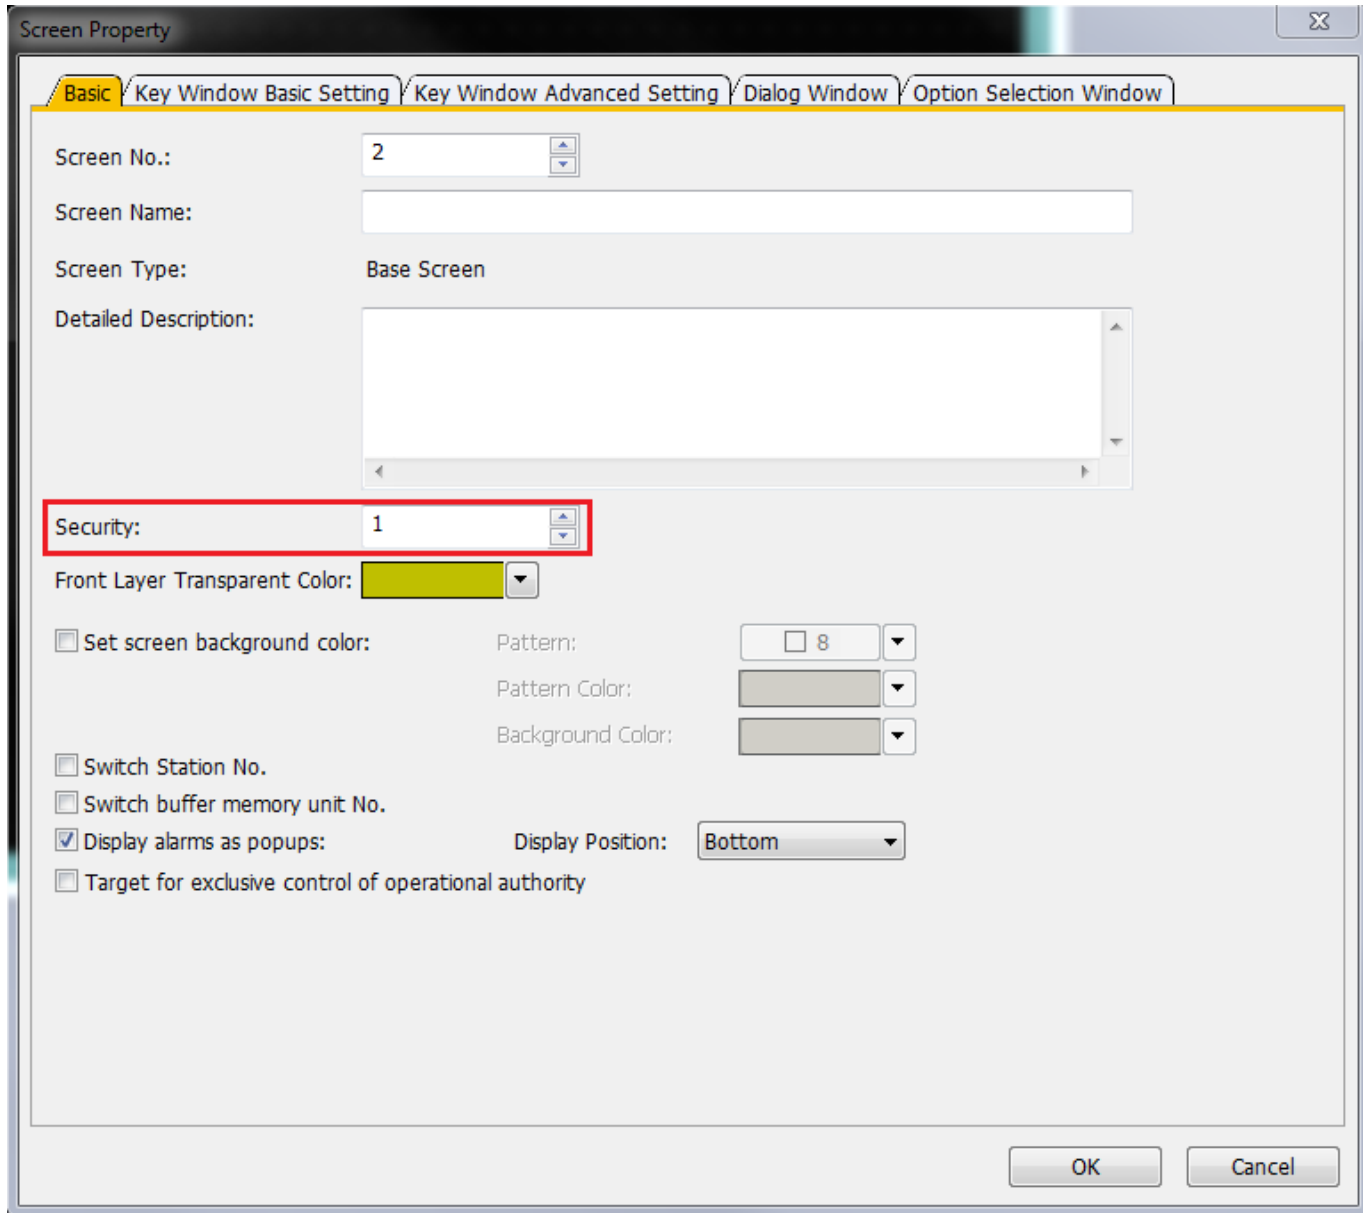

The screenshot shows the 'Screen Property' dialog box with the following settings:

- Screen No.: 2
- Screen Name: (empty)
- Screen Type: Base Screen
- Detailed Description: (empty)
- Security: 1 (highlighted with a red box)
- Front Layer Transparent Color: (yellow)
- Set screen background color: Pattern: 8, Pattern Color: (grey), Background Color: (grey)
- Switch Station No.
- Switch buffer memory unit No.
- Display alarms as popups: Display Position: Bottom
- Target for exclusive control of operational authority


Buttons: OK, Cancel

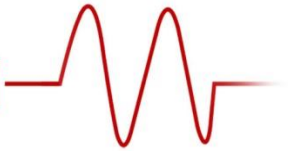

Important Information

When the GOT HMI screen is running and you have entered the password in the prompt keypad the password will remain in the set data register until it has been reset. A suitable way to reset the data register is to use a switch to reset the data register or use a switch to go back to main screen (screen1) and also to reset the data register as the same time.

Example: Switch for screen switch and changing D100 back to '0'

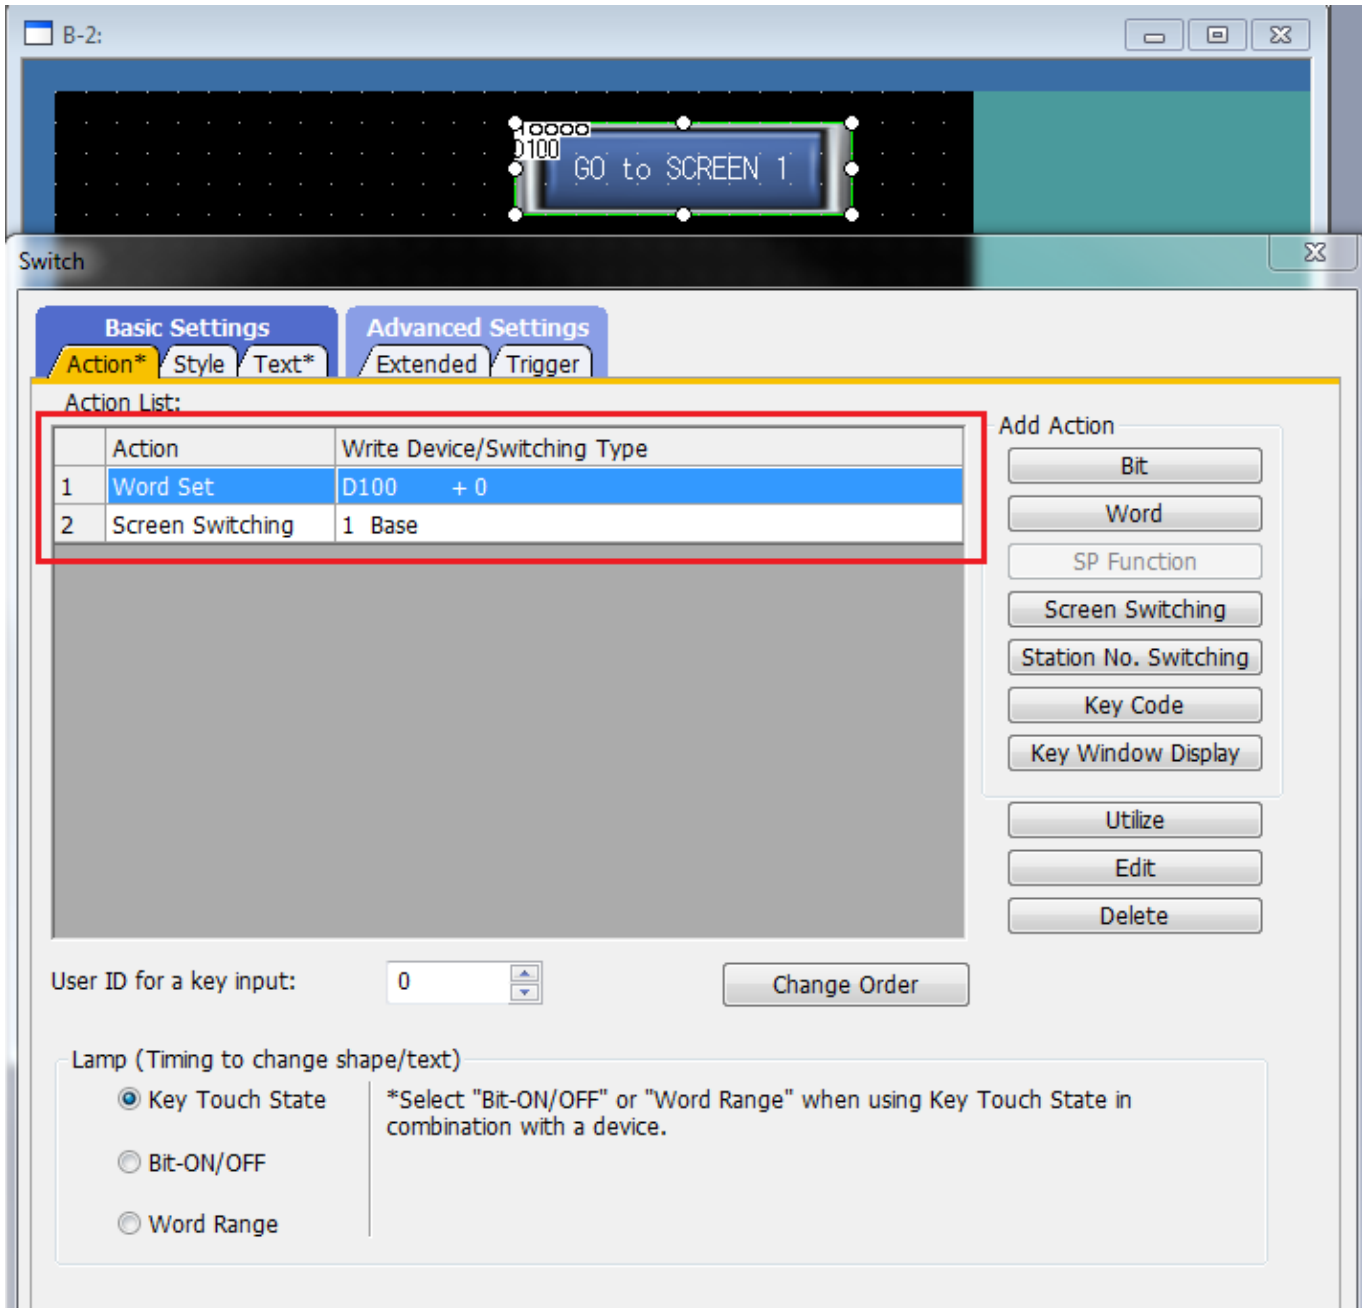

	Action	Write Device/Switching Type
1	Word Set	D100 + 0
2	Screen Switching	1 Base

Once this menu is completed click 'OK'. Your password screen has now been completed.

